


DIAGNOSTIC TROUBLE CODE CHART

DTC No. (See page)	Detection Item	Trouble Area
B2780 (DI-908)	Key Unlock Warning Switch Malfunction	• Key unlock warning switch
B2793 (DI-911)	Transponder Chip Malfunction	• Key (Smart key)
B2794 (DI-912)	Unmatched Encryption Code	• Key (Smart key) • Transponder key amplifier
B2795 (DI-913)	Unmatched key code	• Key (Smart key) • Unregistered key inserted before
B2796 (DI-914)	No communication in immobiliser system	• Key (Smart key) • Transponder key amplifier (w/ Coil) • Wire harness • Transponder key ECU
B2797 (DI-917)	Communication malfunction No.1	• Key (Smart key) • Wire harness • Transponder key amplifier (w/ Coil) • Transponder key ECU
B2798 (DI-921)	Communication malfunction No.2	• Key (Smart key) • Transponder key amplifier (w/ Coil) • Wire harness • Transponder key ECU
B2799 (DI-925)	Engine immobiliser system	• Wire harness • Transponder key ECU • Engine and ECT ECU

HINT:

DTC B2793 – B2798 are used in the Steering Lock ECU and the Transponder Key ECU. Because the same troubleshooting method is applied to both ECUs, the method here is taken from the steering lock section. Therefore the words such as "Steering Lock ECU" and "smart key" are used for the method here.

This illustration shows DTC and the psrts to be checked.
Pleased refer to this illustration at the time of troubleshooting.

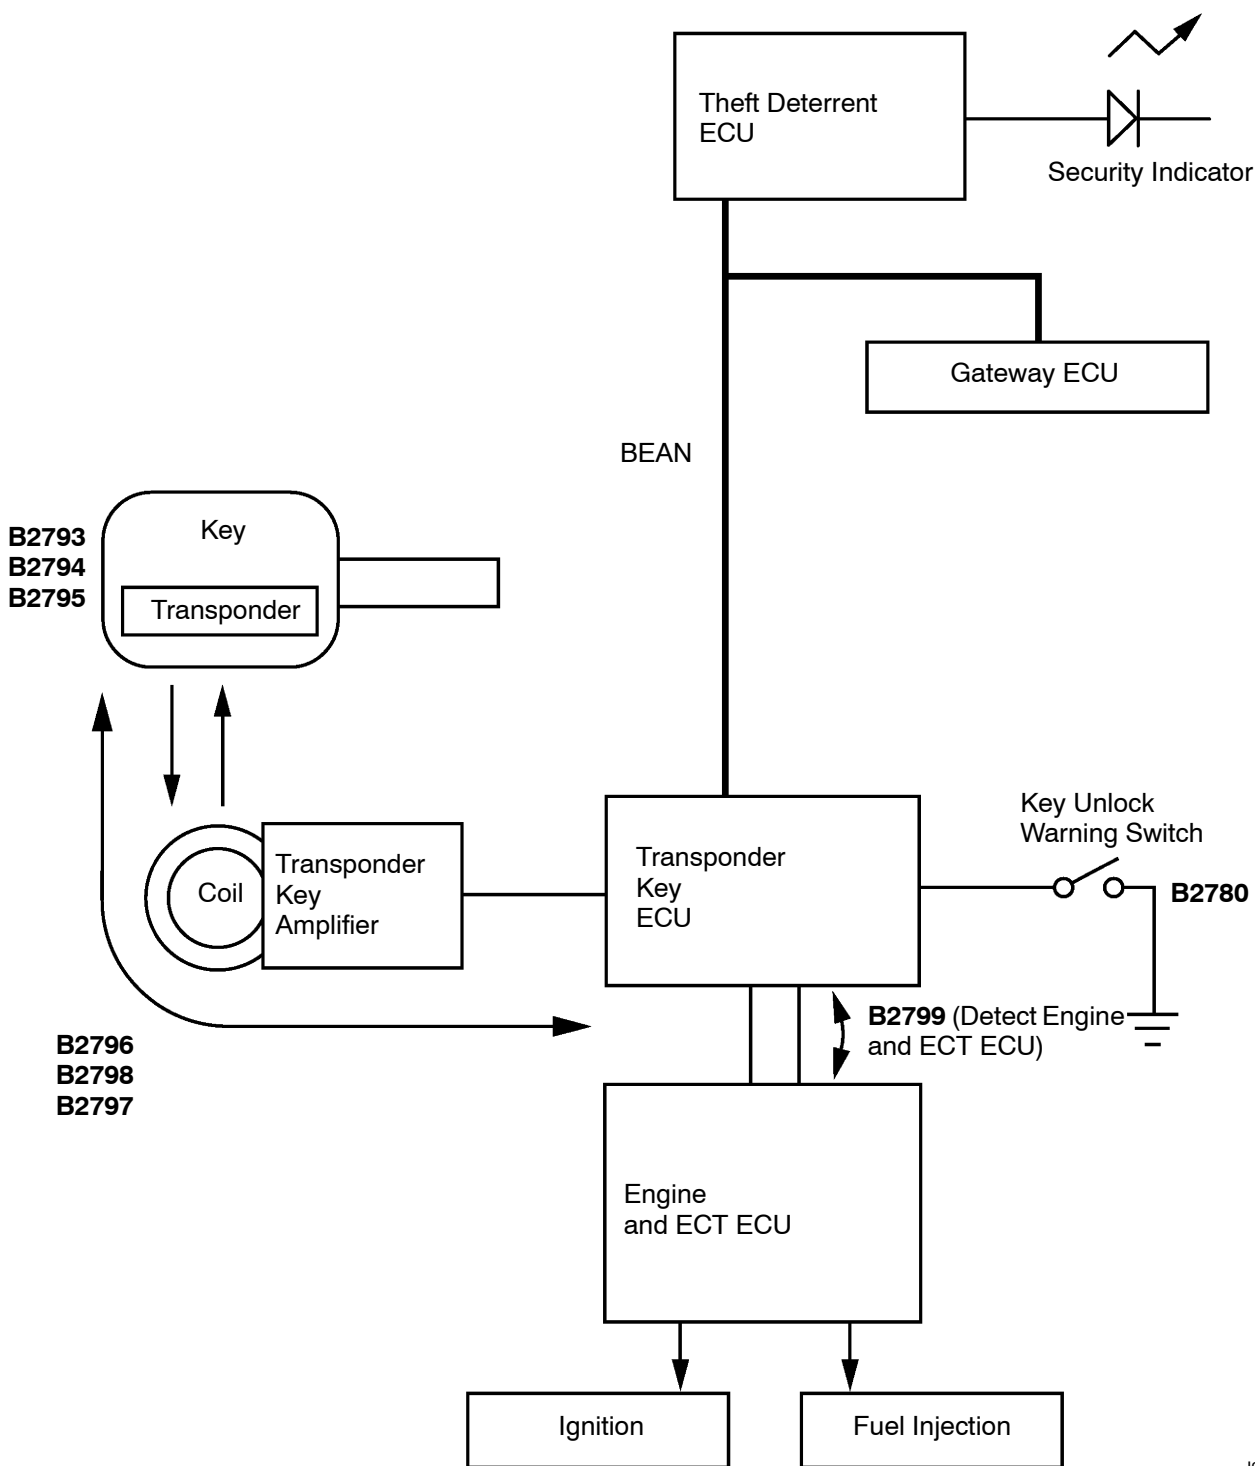

T

I20465