

DTC	B1269	Theft deterrent ECU communication stop
------------	--------------	---

CIRCUIT INSPECTION

This DTC is output when communication stops between the theft deterrent ECU and the gateway ECU.

DTC No.	DTC Detecting Condition	Trouble Area
B1269	No communication from theft deterrent ECU for more than 10 seconds.	• Theft deterrent ECU • Wire harness

WIRING DIAGRAM

See page DI-1482.

INSPECTION PROCEDURE

1	Check wire harness.
----------	----------------------------


PREPARATION:

Pull out the ECU connectors mentioned below.

Wire harness side connector of ECU	Terminal
Theft deterrent ECU - Gateway ECU	MPX2 (T5-33) - MPD1 (G1-4)
Theft deterrent ECU - Transponder key ECU (w/o Smart key system)	MPX1 (T5-13) - MPX2 (T9-5)
Theft deterrent ECU - Steering lock ECU (w/ Smart key system)	MPX1 (T5-13) - MPX2 (S27-6)

CHECK:

Check continuity of the wire harness between the connectors.

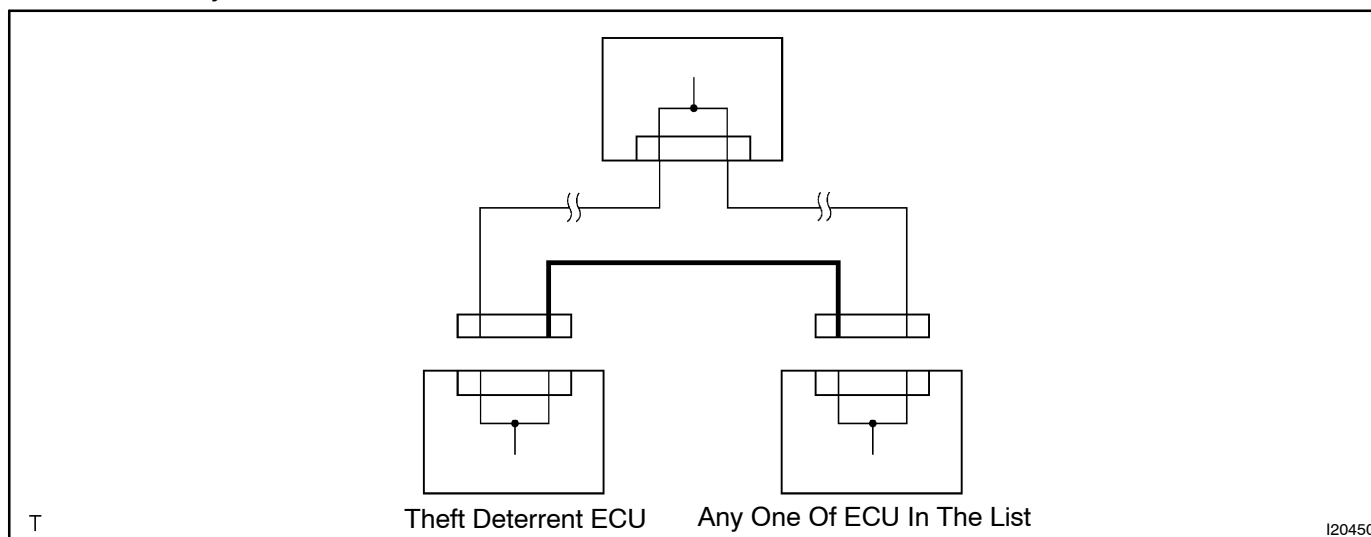

OK:

There is a continuity between the connectors.

HINT:

If there is OPEN in any wire harness, please repair it.

NG**Repair or replace wire harness.****OK****Replace theft deterrent ECU ([See page IN-35](#)).**