

[\[Previous\]](#)
[\[Next\]](#)

DTC Description

DTC DETECTION LOGIC

DTC No.	M.U.T.-III SE screen items (Trouble diagnosis content)	DTC Detection Condition	
		Diagnosis condition	-
U1327-52	MAC key update (Message Authentication Code key update)	Signal (terminal)	-
		Threshold	MAC key writing is incomplete.
		Diagnosis delay time	-

POSSIBLE CAUSE

- Network communication error between M.U.T.-III SE and BCM
- BCM used in other vehicles is installed in the vehicle
- BCM

FAIL-SAFE

DTC CONFIRMATION PROCEDURE

1.CHECK DTC PRIORITY

If DTC U1327-52 is displayed with DTC U1327-54, first perform the trouble diagnosis for DTC U1327-54.

Q. Is DTC U1327-54 detected?

Yes

Refer to [DTC Description](#) .

No



2.PERFORM DTC CONFIRMATION PROCEDURE

 With M.U.T.-III SE

1. Ignition switch ON.
2. Perform “MAC key writing”. Refer to [Description](#) .
3. Perform “MAC Diagnosis” of “BCM” using M.U.T.-III SE.

Q. Is DTC U1327-52 detected as the current malfunction?

 YesRefer to [Diagnosis Procedure](#) . No

-1 To check malfunction symptom before repair: Refer to Intermittent Incident [Intermittent Incident](#) .

 No

-2 Confirmation after repair: INSPECTION END