

# insider info.

## **Subaru Legacy - DTC P0130: Front Oxygen Sensor Circuit Malfunction**

If you encounter a DTC P0130 on a 1995 Subaru Legacy, check that the BR wire in connector B22 (16 pin/light gray—Main Engine Harness) is properly inserted into the connector. This connector is not shown in any wiring diagram related to this code.