


insider info.

insider info.

Front End "Pop" Noise

If you encounter a customer complaint of a noise coming from the front end when turning on all Legacy models (similar to a small stone hitting the floor pan), pivoting front stabilizer bar bushing clamps may be the cause. Use the following information to adjust the clamps:

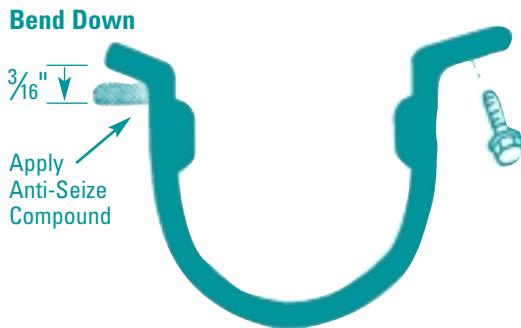

- Remove both right and left bushing clamps. Use Section 4-1 of the applicable Legacy Service Manual.
- To correct the popping noise, bend the tab hook approximately 3/16-inch. Refer to the illustration on this page.
- Coat the underside of the hook with anti-seize compound.
- Re-install in reverse order of disassembly.

Note: A similar production change was made in July, 1992 for FHI-manufactured (Japan) and September, 1992 for SIA-manufactured (Indiana) Legacy models.