



Second Generation 4EAT Trouble Codes

Duty solenoid DTCs on a 1999 model year or later Subaru Legacy, Forester or Impreza with the new (second generation) 4EAT may be caused by dents in the transmission oil pan. Inspect the pan carefully for dents or any other damage.

There are many solenoids and connectors on the bottom of the valve body and there is not a lot of clearance between the bottom of the pan and the solenoid connectors. A dented pan may push against and crack the connectors above it. The resulting transmission problems may also be intermittent in nature.