

List of Diagnostic Trouble Code (DTC)

OCCUPANT DETECTION SYSTEM (DIAGNOSTICS)

12.List of Diagnostic Trouble Code (DTC)

A: LIST

DTC	Display	Content of diagnosis	Reference
2A	ODS Calibration Error	System calibration (Rezeroing) was not completed normally.	<Ref. to OD(diag)-25, DTC 2A ODS CALIBRATION ERROR, Diagnostic Procedure with Diagnostic Trouble Code (DTC).>
2B	ODS System Wrong Parts	<ul style="list-style-type: none"> Wrong airbag control module was installed. Wrong occupant detection system was installed. Occupant detection system is faulty. 	<Ref. to OD(diag)-25, DTC 2B ODS SYSTEM WRONG PARTS, Diagnostic Procedure with Diagnostic Trouble Code (DTC).>
2C	Belt Tension Sensor Failure	<ul style="list-style-type: none"> Passenger's seat belt tension sensor is faulty. Airbag rear harness circuit is open or shorted. Occupant detection system is faulty. Occupant detection harness is faulty. 	<Ref. to OD(diag)-26, DTC 2C BELT TENSION SENSOR FAILURE, Diagnostic Procedure with Diagnostic Trouble Code (DTC).>
27	Occupant Detection System Improper Communication	<ul style="list-style-type: none"> Occupant detection control module and airbag control module communication is faulty. Airbag rear harness circuit is open or shorted. <p>Short circuit to the ground or the power supply.</p> <ul style="list-style-type: none"> Occupant detection harness is faulty. Occupant detection system is faulty. Airbag control module is faulty. 	<Ref. to OD(diag)-28, DTC 27 ODS COMMUNICATION ERROR, Diagnostic Procedure with Diagnostic Trouble Code (DTC).>
29	Occupant Detection System Failure	<ul style="list-style-type: none"> Occupant detection sensor is faulty. Occupant detection control module is faulty. Occupant detection harness is faulty. Fuse No. 6 (in joint box) is blown. 	<Ref. to OD(diag)-28, DTC 29 ODS FAILURE, Diagnostic Procedure with Diagnostic Trouble Code (DTC).>
37	Buckle Switch RH Failure	<ul style="list-style-type: none"> Passenger's buckle switch circuit is open, shorted or shorted to ground. Occupant detection system is faulty. Occupant detection harness is faulty. 	<Ref. to OD(diag)-29, DTC 37 BUCKLE SWITCH RH FAILURE, Diagnostic Procedure with Diagnostic Trouble Code (DTC).>