

4. Speedometer

A: REMOVAL


Disassemble the combination meter, and then remove the speedometer and tachometer assembly.
<Ref. to IDI-13, DISASSEMBLY, Combination Meter Assembly.>

B: INSTALLATION

Install in the reverse order of removal.

C: INSPECTION

Measure the speedometer resistance.

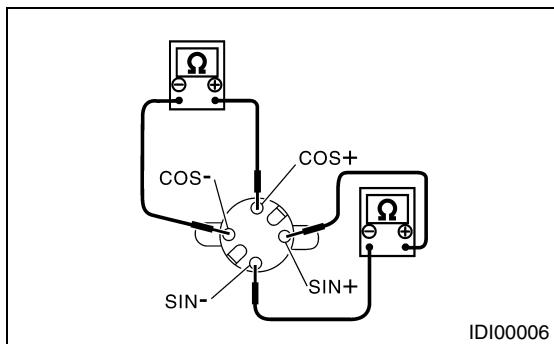

Terminal	Resistance
SIN+ and SIN-	200±8 Ω
COS+ and COS-	200±8 Ω

If NG, replace the speedometer and tachometer assembly.

If OK, replace the combination meter printed circuit.