

# CIRCUIT OPENING RELAY

## INSPECTION



### 1. INSPECT CIRCUIT OPENING RELAY

(a) Continuity inspection.

(1) Using an ohmmeter, check for resistance between the terminals.

#### Resistance

| Terminals | Specified Condition   |
|-----------|---|
| 3 - 5     | 10 k $\Omega$ or higher                                       |
| 3 - 5     | Below 1 $\Omega$<br>(Apply battery voltage terminals 1 and 2) |

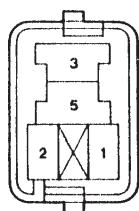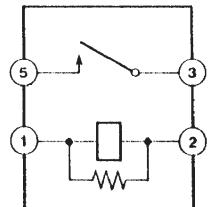

ES