

Vehicle Tow-Hook Removal

Subaru of America, Inc. has determined that a number of 1994-95 Impreza and 1995-96 Legacy vehicles may experience air bag deployment after sharp undercarriage contact with curbing, dips, speed bumps, potholes, etc. Investigation revealed that in most cases the portion of the undercarriage that made contact was the front tow-hooks, which constitute the point of lowest ground clearance at the front of the vehicle.


Subaru of America has notified the potentially affected vehicle owners that they should contact their dealer, who will remove the front tow hooks at no cost to the vehicle owner. If any of your customers own a Subaru vehicle that matches the model and VIN range listed below, advise them to contact an authorized Subaru service department to schedule an appointment (if they have not already done so).

Vehicles Involved

Model Year/Body Style	VIN Range
1994 Impreza Sedan	JF1GF**5*R*540001 — R*541831
1994 Impreza Station Wagon	JF1GF**5*R*840001 — R*840523
1995 Impreza Sedan	JF1GC**5*S*500001 — S*512954
1995 Impreza Station Wagon	JF1GF**5*S*800001 — S*811034
1995 Impreza Coupe	JF1GM**5*S*400001 — S*411538
1995 Legacy Sedan	4S3BD**5*S*210001 — S*238892
1995 Legacy Station Wagon	4S3BK**5*S*310001 — S*362609
1996 Legacy Sedan	4S3BD**5*T*200501 — T*200857
1996 Legacy Station Wagon	4S3BK**5*T*300501 — T*301551

Note 1: Although the involved vehicles are within the above VIN ranges, not all vehicles in this range were sold in the U.S.

Note 2: Various characters may occupy the VIN positions identified by “*”.

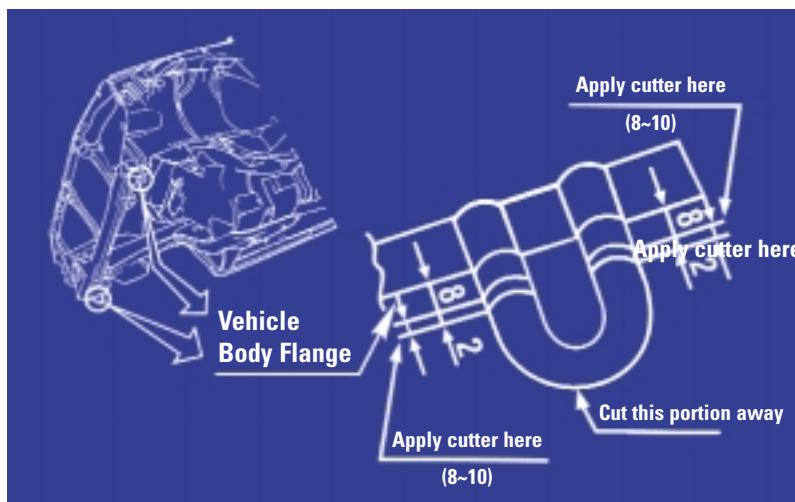

Caution: Do not use cutting torches to cut away tow-hooks.
Excessive heat may damage vehicle paint surfaces.