


insider info.

insider info.

Suspension Squeaking Noise

If you encounter a squeaking noise in the front suspension on a 1995 Legacy (sedan up to VIN S*217985, station wagon up to VIN 5*320378) and a visual inspection of the spring and saddle area shows signs of contact, bend the flange on the lower saddle of the front strut.

Note: The area causing the noise will be identified by a shiny area on the spring and saddle.

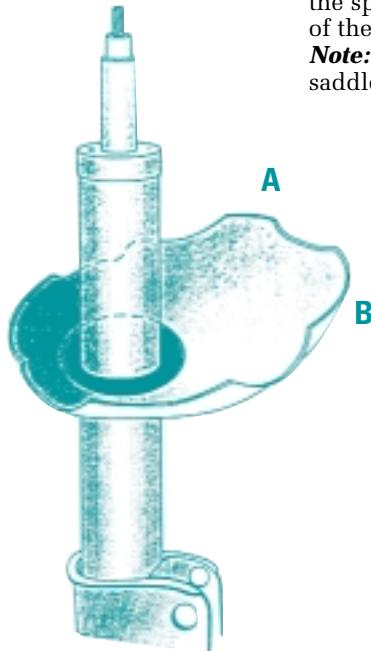

To inspect the suspension:

- Raise the vehicle on a lift.
- Inspect the saddle and spring area of the front struts.
- To eliminate the noise, it is necessary to bend the saddle away from the spring.
- Refer to the illustration on this page. Bend the saddle away from the spring in two areas.
 - A: Bend area "A" outward 2 mm,
 - B: Bend area "B" outward 1 mm.
- Apply undercoating to affected areas of the strut and spring to prevent rust.
- Lower the vehicle and confirm the repair.