

2. Horn System


A: WIRING DIAGRAM

Refer to "Horn System" in WI section. <Ref. to WI-125, WIRING DIAGRAM, Horn System.>

B: INSPECTION

1. HORN RELAY

Measure the horn relay resistance between terminals when connecting terminal No. 4 to the battery positive terminal and terminal No. 3 to the battery ground terminal.

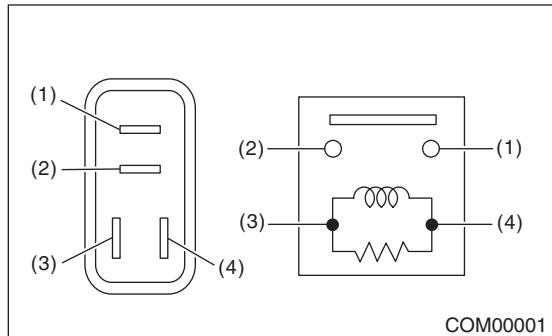

Continuity	Terminal No.	Standard
Yes	1 and 2	Less than 1 Ω
No		1 MΩ or more

C: NOTE

For procedure of each component in the horn system, refer to the respective section.

- Horn assembly <Ref. to COM-4, Horn.>
- Horn switch <Ref. to COM-5, Horn Switch.>