

4. Turn Signal and Hazard Light System

A: SCHEMATIC

1. TURN SIGNAL LIGHT AND HAZARD LIGHT

<Ref. to WI-110, SCHEMATIC, Turn Signal Light and Hazard Light System.>


B: INSPECTION

1. TURN SIGNAL SWITCH

<Ref. to LI-9, INSPECTION, Combination Switch (Light).>

2. HAZARD SWITCH

Measure the hazard switch resistance.

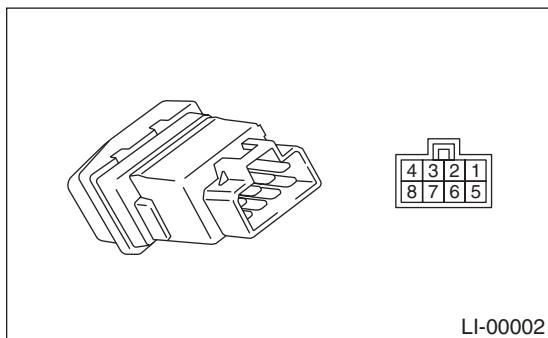

Switch position	Terminal No.	Standard
OFF	6 and 7	Less than 1Ω
ON	1, 3 and 4	Less than 1Ω
	7 and 8	Less than 1Ω

3. TURN SIGNAL & HAZARD MODULE

Connect the battery and turn signal light bulb to the module, as shown in the figure. The module is properly functioning if it blinks when power is supplied to the circuit.

