

4. Spark Plug Cord

A: INSPECTION

Check for:

- 1) Damage to cords, deformation, burning or rust on terminals
- 2) Resistance value of cords


Resistance values:

#1 cord: 5.6 — 10.6 k Ω

#2 cord: 7.3 — 13.7 k Ω

#3 cord: 5.9 — 11.1 k Ω

#4 cord: 7.3 — 13.7 k Ω

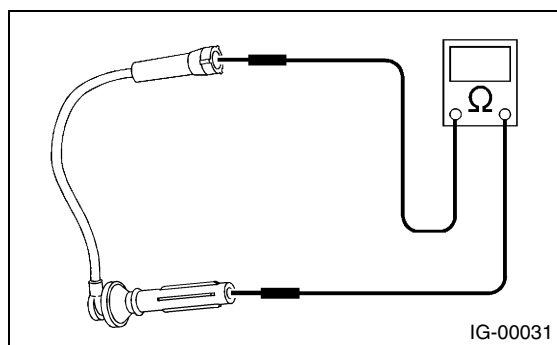

SPARK PLUG CORD

IGNITION
