



Shift Indicator Panel

Adjustment


ACCORD AERO DECK

SRS wire harness is routed near the gearshift selector.

NOTE: LHD is shown; RHD is similar.

CAUTION:

- All SRS electrical wiring harnesses are covered with yellow outer insulation.
- Replace the entire affected SRS harness assembly if it has an open circuit or damaged wiring.

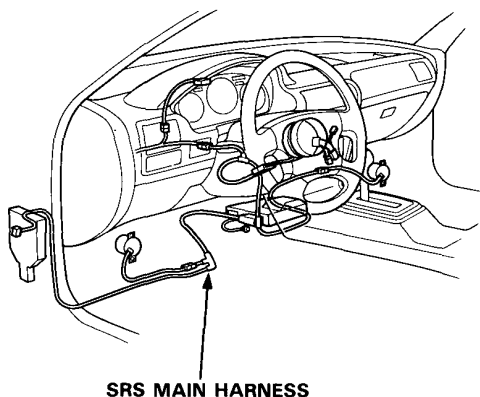

1. Check that the index mark of the indicator aligns with the **N** mark of the shift indicator panel with the transmission in NEUTRAL.
2. If not aligned, remove the center console. (see Section 14).
3. Remove the shift indicator panel mounting screws and adjust by moving the panel.

NOTE: Whenever the shift indicator panel is removed, reinstall the panel as described above.

