

## INSPECTION


### 1. VEHICLE NOT INVOLVED IN A COLLISION

- (a) Perform a diagnostic system check (see page [DI-1851](#)).
- (b) With the front seat airbag assy installed on the vehicle, perform a visual check. If there are any defects as mentioned below, replace the front seatback assy with a new one:

Cuts, minute cracks or marked discoloration on the front seatback assy around the front seat airbag assy.

### 2. VEHICLE INVOLVED IN A COLLISION AND AIRBAG IS NOT DEPLOYED

- (a) Perform a diagnostic system check (see page [DI-1851](#)).

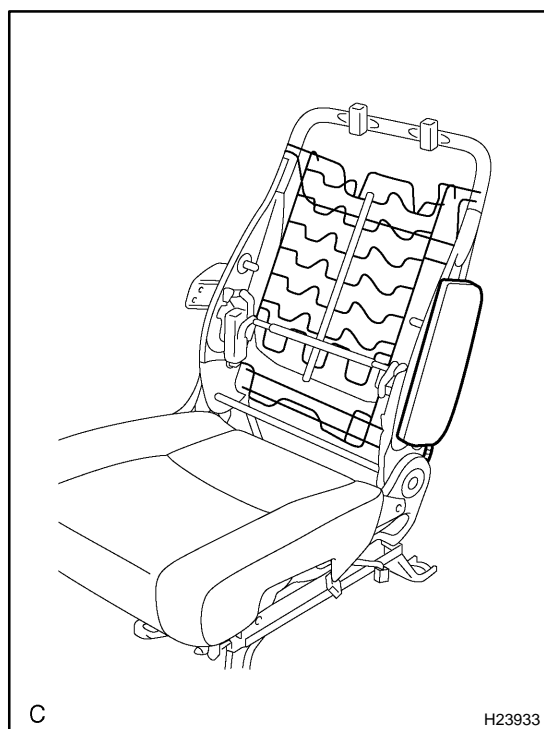

- (b) Perform a visual check which includes the following items with the seatback assembly removed from the vehicle.
  - Cuts, tears and cracks on the side airbag assembly.
  - Cuts and cracks in the wire harness, and chipping in the connectors.

#### CAUTION:

For removal and installation of the front seatback assembly, see page [RS-64](#) and [RS-70](#). Be sure to follow the correct procedure.